

Battery Status Report

SOH Blitz Test

Vehicle Information

/Skoda/Enyaq 2021 >, Elroq 2025 >

Odometer Reading: 71228km

VIN:

Rated Voltage: 352 V

Rated Capacity: 234 Ah

Test Time: 2026-10-20 12:06:18

Testing Organization: Automobilių patikra prieš
pirkimą

Customer:

S/N: V6DGS9V01123


Version: V14.10




Scan to download
PDF



Battery Status

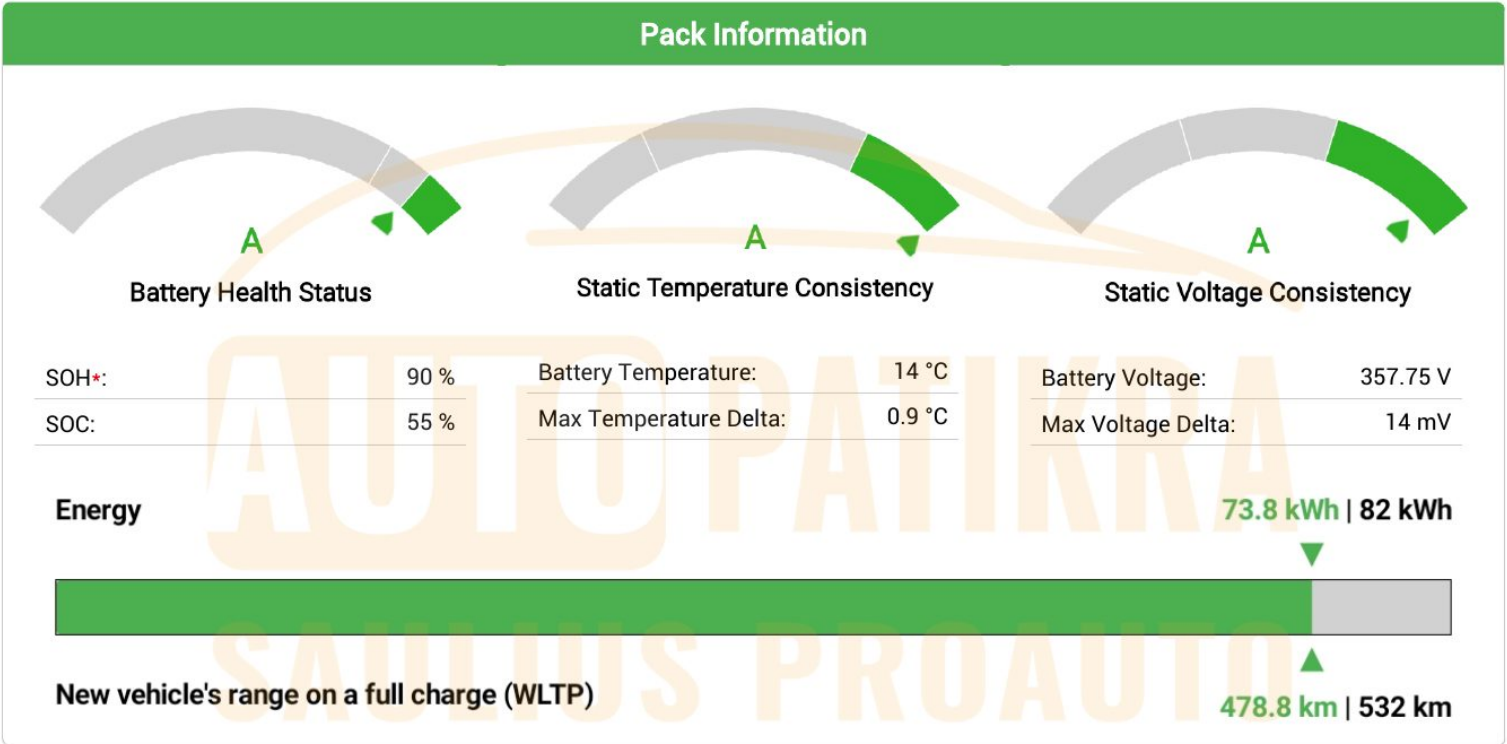

*: Based on the BMS data or related data of the vehicle manufacturer. Autel provides no guarantee regarding the actual SOH or physical condition of the battery.

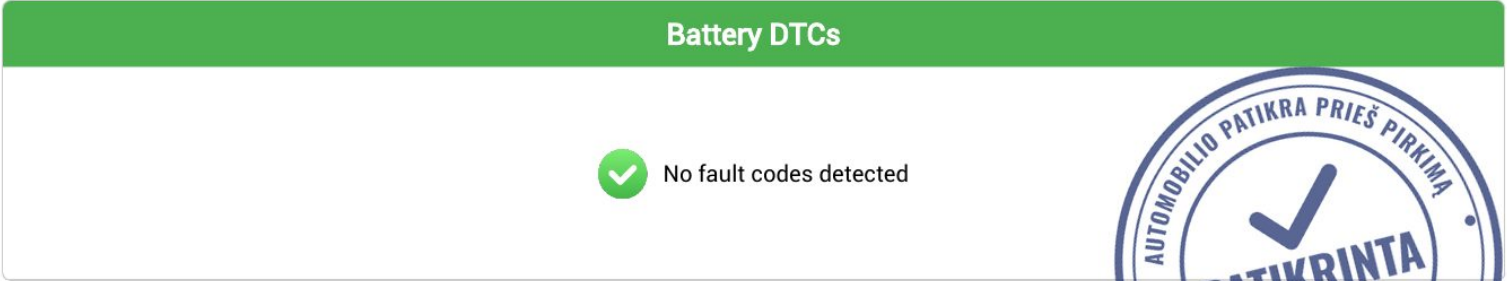

Test Parameters

Module Voltage Information			
Maximum Module Voltage:	29.83 V	Minimum Module Voltage:	29.78 V
Average Module Voltage:	29.8 V	Module Voltage Delta:	0.05 V
Standard Module Voltage Delta:	0.01 V		
Maximum Cell Voltage:	3.732 V	Minimum Cell Voltage:	3.718 V
Average Cell Voltage:	3.725 V	Cell Voltage Delta:	14 mV
Standard Cell Voltage Delta:	2 mV		

LowHigh

Warning

Not OK

Module		Cell							
		1	2	3	4	5	6	7	8
M1 (#1-#8)	29.8 V	3.723 V	3.726 V	3.725 V	3.727 V	3.724 V	3.725 V	3.724 V	3.724 V
M2 (#9-#16)	29.8 V	3.723 V	3.725 V	3.724 V	3.726 V	3.725 V	3.726 V	3.727 V	3.723 V
M3 (#17-#24)	29.8 V	3.724 V	3.724 V	3.725 V	3.725 V	3.724 V	3.725 V	3.724 V	3.724 V
M4 (#25-#32)	29.79 V	3.722 V	3.725 V	3.723 V	3.723 V	3.724 V	3.725 V	3.722 V	3.722 V
M5 (#33-#40)	29.78 V	3.722 V	3.724 V	3.722 V	3.725 V	3.726 V	3.726 V	3.722 V	3.718 V
M6 (#41-#48)	29.79 V	3.722 V	3.725 V	3.725 V	3.725 V	3.724 V	3.723 V	3.725 V	3.722 V
M7 (#49-#56)	29.8 V	3.723 V	3.724 V	3.725 V	3.726 V	3.727 V	3.727 V	3.725 V	3.723 V
M8 (#57-#64)	29.79 V	3.721 V	3.725 V	3.724 V	3.725 V	3.725 V	3.726 V	3.723 V	3.722 V
M9 (#65-#72)	29.8 V	3.724 V	3.724 V	3.723 V	3.725 V	3.726 V	3.724 V	3.723 V	3.726 V
M10 (#73-#80)	29.8 V	3.722 V	3.722 V	3.725 V	3.725 V	3.724 V	3.726 V	3.726 V	3.725 V
M11 (#81-#88)	29.79 V	3.724 V	3.725 V	3.723 V	3.723 V	3.724 V	3.725 V	3.722 V	3.723 V
M12 (#89-#96)	29.83 V	3.729 V	3.732 V	3.73 V	3.731 V	3.729 V	3.728 V	3.727 V	3.727 V



Module Temperature Information

Max Temperature: 14 °C

Min Temperature: 13.1 °C

Average Temperature: 13.6 °C

Low High

 Warning Not OK

	1	2	3	4	5	6	7	8
M1 (T1-T2)	14 °C	13.6 °C						
M2 (T3-T4)	14 °C	13.5 °C						
M3 (T5-T6)	13.9 °C	13.3 °C						
M4 (T7-T8)	13.6 °C	13.4 °C						
M5 (T9-T10)	13.8 °C	13.5 °C						
M6 (T11-T12)	13.8 °C	13.6 °C						
M7 (T13-T14)	14 °C	13.5 °C						
M8 (T15-T16)	14 °C	13.6 °C						
M9 (T17-T18)	13.6 °C	13.1 °C						
M10 (T19-T20)	13.8 °C	13.4 °C						
M11 (T21-T22)	13.3 °C	13.1 °C						
M12 (T23-T24)	13.4 °C	13.3 °C						

**AUTO PATIKRA**

Testing Organization: Automobilių patikra prieš pirkimą

Address:

Tel:

Email: info@sauliusproauto.lt

Technician:

Date:

Note: Please save a copy of this report for your records.

Disclaimer:

1. All data presented in this report are sourced from the original BMS data of the vehicle manufacturer or related derivative data. Due to factors such as delayed data updates or transmission latency, the report data may differ from the actual condition of the battery.
2. The results generated by this feature and its corresponding analysis strategy are for reference only. Autel makes no warranties regarding the authenticity, accuracy, or completeness of the data, and provides no guarantee, whether express or implied, regarding the actual SOH or physical health status of the battery. By using this feature, you are deemed to have agreed to and accept all terms of this disclaimer.
3. This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.